

# Canon Service Bulletin Comp. Systems

Issued by Canon Europa N.V.

S630, S750, S6300, i950, i850, MODEL: No.: PRNT-1216

> i550, i6100, i6500 (Q-12E-0063)


Date: 30.05.03

LOCATION: **PART CHANGE NOTICE** 

SUBJECT: **NEW DESIGNATION OF PAPER FEED MOTOR** 

### **DETAILS**

To improve serviceability, the paper feed motor (secured with 2 red screws) has been designated as a service part.

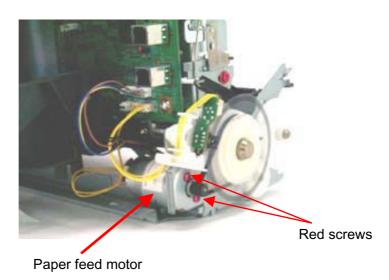

## **SERVICE PARTS**

NO.		DESCRIPTION	PART NUMBER	Q'TY	IC	P.C.
1	0					S630
	Ν	MOTOR, PAPER FEED	QH4-4342-000	0 – 1		
2	0					S750
	Ν	MOTOR, PAPER FEED	QH4-4433-000	0 – 1		
3	0					i950
	Ν	MOTOR, PAPER FEED	QH4-4461-000	0 – 1		
4	0					i850/i550
	Ν	MOTOR, PAPER FEED	QH4-4459-000	0 – 1		
5	0					i6100, i6500
	Ν	MOTOR, PAPER FEED	QH4-4373-000	0 – 1		S6300

### **SERVICE TIP**

### 1. Details of change

Removal of the paper feed motor in servicing was not allowed, as belt tension adjustment using the tool was required after re-attachment. However, as it has been confirmed that the paper feed motor can be replaced without using the tool, the part has been designated as a service part.

### 2. Caution

The paper feed motor should be removed only when necessary. When attaching it, be careful of the following points:

- (1) In attaching the paper feed motor, position the motor so that the belt is pulled tight, and fasten the screws.
- (2) After paper feed motor replacement, be sure to perform the service test print, and confirm that no strange noise or improper printing (such as due to dislocation of the belt, or out-of-phase of the motor, etc.) occurs.