

# CATION SERVICE BULLETIN COMP. SYSTEMS

Issued by Canon Europa N.V.

i9100, i6500, i6100 MODEL: No.: PRNT-1230

(Q-12E-0067)

Date: 25.07.03

LOCATION: **PURGE UNIT** 

SUBJECT: **SCREW CHANGE** 

#### **DETAILS**


For quality improvements, the tapping screw securing the wiper cleaner ass'y to the purge unit has been changed.

- Old: M3 x 6 B-tight screw

- New: M3 x 8 P-tight screw

The old and new screws are NOT compatible.

## **Tapping Screw**

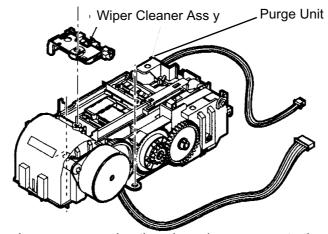

Tapping screw securing the wiper cleaner ass y to the purge unit

When replacing the wiper cleaner ass'y,

- 1. Use the removed screw.
- 2. If the removed screw is missing, be sure to use the same type of screw as the original screw.

#### **SERVICE PART**

DESCRIPTION		PART NO	Q'TY	IC	P.C.
0					
N	SCREW, TAP M3X8	XA9-1169-000	0 – 1		

#### **SERVICE TIP**

### Details of change

With the previous screw, a crack was found on the boss of the purge unit where the wiper cleaner was secured.

To prevent cracks, the screw has been changed from B-tight to P-tight.

#### **Precaution**

# When replacing only the wiper cleaner ass'y:

- (1) Use the removed screw in fastening the replaced wiper cleaner ass'y.
- (2) If the removed screw is missing, use the same type of screw as the original screw.

Reason: In securing the wiper cleaner ass'y to the purge unit, the boss hole is tapped by the screw. If a different type of screw is used, the original screw thread may be damaged, and the screw cannot be fastened.

## When replacing both the wiper cleaner ass'y and the purge unit:

- (1) Use the removed screw.
- (2) If the removed screw is missing, <u>either the old or new type of screw can be used</u>.

  Reason: There is no screw thread inside the boss hole, as the service part purge unit is unused (new from the inventory).